

PreKote™

Surface Pretreatment

PreKote SP Field Repair Instructions (Read Before Use)

This kit contains enough material to repair a 2 ft by 2ft square area

Note: PreKote SP (4 oz) and Rinse Water (8 oz) will be used in three (3) steps: Only use 1/3 of each bottle during each step.

1. First Application of PreKote SP (B-1)

Use only 1/3 of the PreKote SP (B-1) bottle.

Spray evenly across the surface to be repaired with PreKote SP (B-1).

2. Surface Scrub

Using the Scrub Pad (S-1), thoroughly scrub the surface sprayed.

3. Water Rinse

Use only 1/3 of the Rinse Water (B-2) bottle.

Spray Rinse Water (B-2) and rinse the PreKote SP from the surface.

Use the Absorbent Pad (A-1) to catch any run off.

4. Wipe

Thoroughly wet Wipe (W-1) with Rinse Water (B-2) and use Wipe (W-1) to remove any remaining residue from the surface. The repair area should now be very clean. Set aside Wipe (W-2) for later use.

5. Second Application of PreKote SP

Use 1/3 of the Prekote SP (B-1) bottle.

Thoroughly spray the surface with PreKote SP (B-1).

6. Scrub Surface

Scrub using Scrub Pad (S-2). Do not rinse. Let the surface dry completely before proceeding to Step 7. A wax like membrane should form.

7. Third Application of PreKote SP

Use last 1/3 of the PreKote SP (B-1) bottle

Thoroughly spray the dried surface with PreKote SP (B-1)

8. Scrub Surface

Scrub the surface to remove the dried the PreKote SP (reusing Scrub Pad S-2) and **immediately** proceed to Step 9.

9. Final Rinse

Thoroughly rinse with the remainder of the Rinse Water (B-2) to remove the PreKote SP from the surface.

Use Absorbent Pad (A-1) to catch any run off. Let the surface completely dry before proceeding to Step 10.

10. Final Step

Use Wipe (W-2) to wipe down the area to be repaired. Ensure the surface is completely dry. The surface is now ready to be painted.

Please contact Pantheon Chemical at 888.608.7888 if you have any questions.

